



WT6000 Wearable Computer & RS6000 Bluetooth Ring Scanner Accessories Guide

Charging Options

Single Cradles



WT6000 Single Slot Cradle w/Spare Battery Charger:

CRD-NGWT-1S1BU-01: Single slot USB Cradle, w/spare battery charging, charges one wearable terminal and one spare battery.

Allows USB communication to the device with an additional micro-USB cable.

Requires: Power Supply PWRS-14000-148R and Country Specific 3 wire AC Line Cord.

Additional accessories for single slot cradle



25-124330-01R

Micro-USB to USB Cable for single slot cradle



PWRS-14000-148R

Power supply for single slot cradle: 100-240 VAC, 12VDC, 4.16A. **Requires:** Country specific AC grounded line cord.



23844-00-00R

US AC line cord, 7.5 feet long, grounded, three wire for power supplies.

Charging LED indicators

Off	Battery not charging
Solid Amber	Healthy battery charging
Solid Green	Healthy battery charging complete
Fast Blink Red	Charging error
Solid Red	Unhealthy battery charging or fully charged

Charging Options

Single Cradles



RS6000 Single Slot Cradle w/Spare Battery Charger:

CRD-NGRS-1S1BU-01: Single slot USB Cradle, w/spare battery charging, charges one ring scanner and one spare battery.

Allows USB communication to the device with an additional micro-USB cable.

Requires: Power Supply PWRS-14000-148R and Country Specific 3 wire AC Line Cord.

Additional accessories for single slot cradle



25-124330-01R

Micro-USB to USB Cable for single slot cradle



PWRS-14000-148R

Power supply for single slot cradle: 100-240 VAC, 12VDC, 4.16A. **Requires:** Country specific AC grounded line cord.



23844-00-00R

US AC line cord, 7.5 feet long, grounded, three wire for power supplies.

Charging LED indicators

Off	Battery not charging
Solid Amber	Healthy battery charging
Solid Green	Healthy battery charging complete
Fast Blink Red	Charging error
Solid Red	Unhealthy battery charging or fully charged

Charging Options

Two-Slot Cradle



WT6000/RS6000 Two Slot Cradle:

CRD-NWTRS-2SUCH-01: 2slot USB Cradle, charges one wearable terminal and one ring scanner.

Allows USB communication to each device with an additional micro-USB cable.

Requires: Power Supply PWRS-14000-148R and Country Specific 3 wire AC Line Cord.

Additional accessories for single slot cradle



25-124330-01R

Micro-USB to USB Cable for single slot cradle



PWRS-14000-148R

Power supply for single slot cradle: 100-240 VAC, 12VDC, 4.16A. **Requires:** Country specific AC grounded line cord.



23844-00-00R

US AC line cord, 7.5 feet long, grounded, three wire for power supplies.

Charging LED indicators

Off	Battery not charging
Solid Amber	Healthy battery charging
Solid Green	Healthy battery charging complete
Fast Blink Red	Charging error
Solid Red	Unhealthy battery charging or fully charged

Charging Options

Five-Slot Cradles



Five-Slot Cradle options:

CRD-NGWT-5S5BC-01: WT6000 5Slot Charge Only Cradle w/Spare Battery Charger, charges up to 5 wearable terminals and 5 spare batteries.

CRD-NGRS-5S5BC-01: RS6000 5Slot Charge Only Cradle w/Spare Battery Charger, charges up to 5 ring scanners and 5 spare batteries.

CRD-NGWT-5S5BE-01: WT6000 5Slot Ethernet Cradle w/Spare Battery Charger, charges up to 5 ring scanners and 5 spare batteries.

CRD-NGRS-5S5BE-01: RS6000 5Slot Ethernet Cradle w/Spare Battery Charger, charges up to 5 ring scanners and 5 spare batteries.

All Cradles Require: Power Supply PWRS-14000-241R, DC Cord 50-16002-029R and Country Specific 3 wire AC Line Cord.

Additional accessories



PWRS-14000-241R

Power supply for 4 slot cradles:90-264 VAC, 12VDC, 9A.



50-16002-029R

DC cable provides power from the power supply to 4 slot Charge and Ethernet cradles



23844-00-00R

US AC line cord, grounded, three wire for power supplies.



BRKT-SCRD-SMRK-01

Rack/Wall Mounting bracket for multi-slot cradles.

Charging LED indicators

Off	Battery not charging
Solid Amber	Healthy battery charging
Solid Green	Healthy battery charging complete
Fast Blink Red	Charging error
Solid Red	Unhealthy battery charging or fully charged

Charging Options

Ten-Slot Cradles



Ten-Slot Cradle options:

CRD-NWTRS-10SCH-01: WT6000/RS6000 10Slot Charge Only Cradle, charges up to 5 wearable terminals and 5 ring scanners.

CRD-NGWT-10SCH-01: WT6000 10Slot Charge Only Cradle, charges up to 10 wearable terminals.

CRD-NGRS-10SCH-01: RS6000 10Slot Charge Only Cradle, charges up to 10 ring scanners

All Cradles Require: Power Supply PWRS-14000-241R, DC Cord 50-16002-029R and Country Specific 3 wire AC Line Cord.

Additional accessories



PWRS-14000-241R

Power supply for 4 slot cradles:90-264 VAC, 12VDC, 9A.



50-16002-029R

DC cable provides power from the power supply to 4 slot Charge and Ethernet cradles



23844-00-00R

US AC line cord, grounded, three wire for power supplies.



BRKT-SCRD-SMRK-01

Rack/Wall Mounting bracket for multi-slot cradles.

Charging LED indicators

Off	Battery not charging
Solid Amber	Healthy battery charging
Solid Green	Healthy battery charging complete
Fast Blink Red	Charging error
Solid Red	Unhealthy battery charging or fully charged

Multi-Slot Cradle Installations



Battery / battery charging accessories

3350 mAh Battery



BTRY-NWTRS-33MA-01

PowerPrecision+ Lithium Ion battery, 3350 mAh. Advanced battery technology, provides higher level of intelligence (State of Charge and State of Health) for wearable terminal or ring scanner.

Spare Battery Charging Options:



SAC-NWTRS-4SCH-01: 4-slot battery charger, charges four spare batteries. **Requires:** Power supply PWRS-14000-148R and Country Specific 3 wire AC Line Cord.



SAC-NWTRS-20SCH-01: 20-slot battery charger, charges twenty spare batteries. **Requires:** Power supply PWRS-14000-241R, DC and Country Specific 3 wire AC Line Cord.

Accessories for battery chargers:



PWRS-14000-148R

Power supply for 4slot battery charger: 100-240 VAC, 12VDC, 4.16A. **Requires:** Country specific AC grounded line cord.



23844-00-00R

US AC line cord, 7.5 feet long, grounded, three wire for power supplies.



50-16002-029R

DC cable provides power from the power supply to 20Slot battery charger.



PWRS-14000-241R

Power supply for 20slot battery charger: 90-264 VAC, 12VDC, 9A. **Requires:** DC and country specific AC grounded line cord.



BRKT-SCRD-SMRK-01

Rack/Wall Mounting bracket for multi-slot cradles and 20slot battery charger.

Cables/Adapters

USB/Charge Cable

CBL-NGWT-USBCHG-01

Provides USB communication and charges the wearable terminal. **Requires:** For AC charging, power supply PWRS-14000-249R and country specific un-grounded AC line cord.



Audio Cables

CBL-NGWT-AUQDLG-01

Audio adapter cable, compatible with quick-disconnect wired headsets. Compatible while the device is worn on the hip. **Requires:** QD headset.



CBL-NGWT-AUQDST-01

Audio adapter cable, compatible with quick-disconnect wired headsets. Compatible while the device is worn on the wrist. **Requires:** QD headset.



Other Cables

CBL-NGWT-HDVBAP-01

Vibrating cable, connects directly to the wearable terminal and provides additional haptic feedback to the user.



PWRS-14000-249R

Power Supply: 100-240VAC, 5.4 VDC, 3A. **Requires:** Country-specific ungrounded AC line cord.



50-16000-182R

US AC line cord, un-grounded, two-wire for power supplies PWRS-14000-249R.



RCH51

Rugged wired headset with quick-disconnect



25-129938-02R

Training cable - Y Cable to connect two wired headsets to one mobile computer

Soft-Goods

Wearable Terminal



Wrist Mount options:

SG-NGWT-WRMTS-01: WT6000 Wrist Mount, includes carrier, comfort pad and small/medium strap.

SG-NGWT-WRMTL-01: WT6000 Wrist Mount, includes carrier, comfort pad and medium/large strap.

Additional accessories



SG-NGWT-WSTPST-01

Spare replacement strap for wrist mount (small/medium)



SG-NGWT-WSTPLN-01

Spare replacement strap for wrist mount (medium/large)



SG-WT4027050-01R

Optional arm sleeves for wrist mount (pack of 5)



SG-NGWT-CMPD-01

Replacement comfort pad for wrist mount.



SG-NGWT-HPMNT-01

Hip-mount for wearable terminal, allows to use the device on the hip.

Soft-Goods: Wrist Mount



- **Velcro removed**
- **One Adjustable strap instead of two**
- **Integrated BOA closure system**
 - Strong
 - Durable
 - Easy to use
- **Specific Materials chosen for hygienic reasons**
 - Can be cleaned down on site
 - Non absorbent



BOA closure system

Specific Materials chosen for grip and wipe down qualities

Soft-Goods: Comfort Pad



Orientation Feature

Allows user to know which way to replace the comfort pad

Large Over lap

- Retains comfort pad to carrier
- Easy to peel off the comfort pad when wanting to remove

Airflow Pattern for breathability

Soft-Goods: Wrist Strap



Improved ease of
removal of strap from
carrier

Retaining Rib holding
elastic cord in place
when not under load


Two size straps to cover the many
various sizes of users

Small Strap

Large Strap



White Dial and
accent colour call out
for Small Strap
Identification

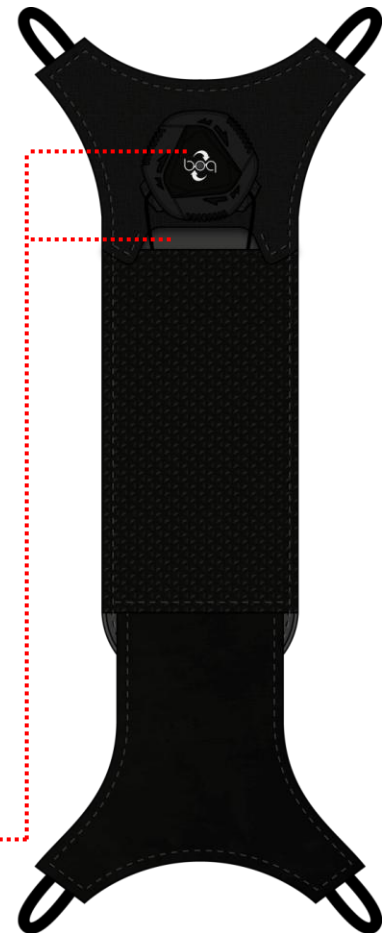

Black Dial and
accent colour call out
for Large Strap
Identification

Soft-Goods

Ring Scanner

Spare Accessories Ring Scanner

SG-NGRS-STRPK-10

RS6000 SPARE FINGER STRAP FOR TRIGGER CONFIGURATION (KIT WITH QTY.10)



SG-NGRS-TRGA-01

RS6000 SPARE TRIGGER ASSEMBLY

SG-NGRS-STRPK2-10

RS6000 SPARE FINGER STRAP FOR TRIGGER-LESS CONFIGURATION (KIT WITH QTY.10)



SG-NGRS-CMPD-01

RS6000 SPARE COMFORT PAD (KIT INCLUDES MAIN AND REAR COMFORT PADS)



SG-NGRS-STBKL-10

RS6000 SPARE STRAP BUCKLES FOR TRIGGER AND TRIGGER-LESS CONFIGURATIONS (KIT WITH QTY.10)



SG-NGRS-TRLH-01

RS6000 SPARE TRIGGERLESS STRAP HOLDER